

ELVITA

Service Bulletin

This document is only intended for internal use and for authorized service partners.

Product category:	Tumbledryer
Affected models:	CTT7800V, CTT7100V
Release:	1.0, 2023-04-03

Compressor terminals falls off

Description:


Due to too stretched cables in harness up to the compressor terminal there has been cases where the compressor terminal comes loose caused by vibrations from transporting the product and when the machine is running. The most common error description from the customer is poor/no drying.

Action:

Remove black tape from the terminal and 40 mm down on the harness.

Pull harness at the bottom to the right about 35 mm and fix it with a new cable tie.

Important! Make sure no electrical cables are in contact with or at risk to any refrigerant pipes. Risk of fire!

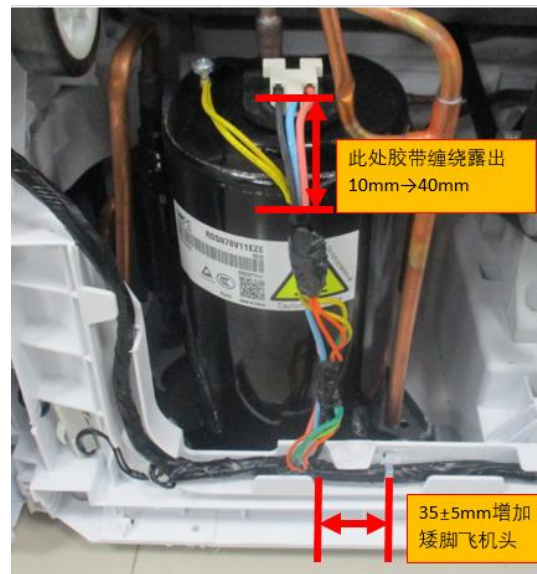

Recommended tools:	<ul style="list-style-type: none">• Nipper• Cable ties
---------------------------	---

IRIS-code:

Condition 1	Symptom A14	Action B	Defect F	Component G08
-----------------------	-----------------------	--------------------	--------------------	-------------------------